


QuickDraw has the functionality to blow out the sprayer hose at the completion of a batch or recipe. Once the batch has finished and the water supply valves have closed, the air purge valve opens for a user settable time in order to blow out the hose and make handling the sprayer hose easier.

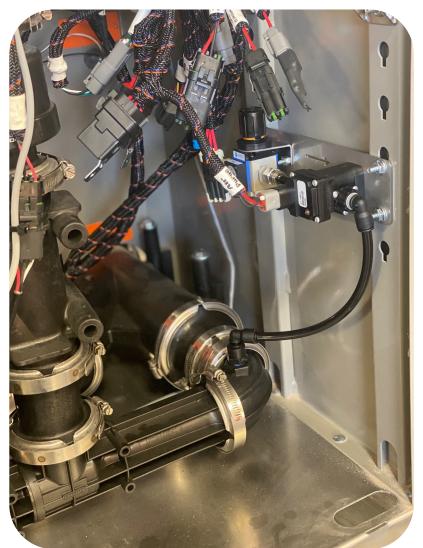





Page 1 © 2020 SureFire Ag Systems, Inc.



606-03-300150 - QuickDraw Air Purge Kit (MY2021 and Newer) Parts List & Installation Instructions

| ITEM NO. | PART NUMBER | DESCRIPTION | QTY. |
|-------------|------------------|--|------|
| 1 | 103-4496Y1 | Zip Valve 1/4" Nylon, 2-way, SS Ball, 3/8" Push to Connect | |
| 2 | 113-12-038038 | Stem Elbow - 3/8" Stem x 3/8" QC | 2 |
| 3 | 137-MGR200-08L | Air Pressure Regulator w/ 60 psi Gauge – ¼" NPT Inlet/Outlet | 1 |
| 4 | 304-040012-5 | Carriage Bolt - 1/4" x 3/4" G5 | 4 |
| 5 | 323-04 | 1/4" Flange Nut | 4 |
| 6 | 330-1024 | Size 10 Flat Washer | 2 |
| 7 | 340-100012 | Machine Screw - Size 10 x 3/4" | 2 |
| 8 | 385-043-AP1 | Bulk 3/8" Tubing | 1 |
| 9 | 385-50-038025-CZ | 3/8" Tube to 1/4 NPT Straight - Pneumatic Fitting | 1 |
| 10 | 385-51-038025-CZ | 3/8" Tube to 1/4 NPT 90 Elbow - Pnuematic Fitting (Not Used) | 1 |
| 11 | 475-4852Y1 | QuickDraw Air Purge Regulator/Valve Mounting Bracket | 1 |
| 12 | 757-97349A200 | Size 6 Thread Forming Screw for Plastic - SS | 3 |

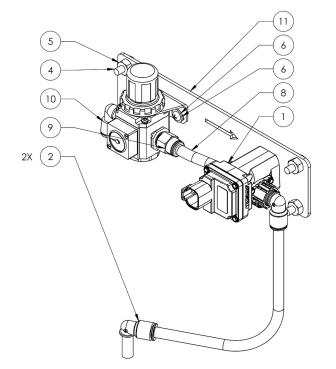

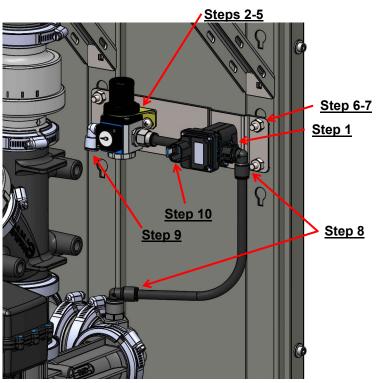

Assembly Instructions for MY2021 and newer:

Note: For ease of access, it is recommend to remove the back QuickDraw door.


- 1. Mount the electric on/off valve to mounting bracket using (3) Size 6 Thread Forming Screws
- 2. Install 1/4" MPT x 3/8" fittings into the Air Pressure Regulator as shown.
- 3. Cut 3/8" Pneumatic tubing to approximately 3-3/4" and install in zip valve.
- 4. Push to connect the air regulator to the tube.
- 5. Mount the Air Pressure Regulator to the mounting bracket using the Size 10 machine screw, flat washer and nylock.
- 6. Loosely install 1/4" flange nuts onto the carriage bolts.
- 7. Slide assembly in Battery Tray key slots and tighten flange nuts.
- 8. Install 3/8" Stem x HB fittings in the outlet of the Zip Valve and into the check valve in the QuickDraw Main Plumbing assembly, in the 2" full port sweep fitting. (*This step is not applicable to QuickDraw Max Suction, see page 3*)
- 9. Connect air supply to the pressure regulator inlet fitting and set the Air Pressure Regulator to 20-25 PSI.
- 10. Plug the "Air Purge" connector in the main QuickDraw Harness into the air supply valve (4-Pin Deutsch Connector).

396-4876Y1 - QuickDraw 3000 Air Purge Installation Manual Page 2 © 2020 SureFire Ag Systems, Inc.




606-03-300160 - QuickDraw^{MAX} Suction Air Purge Kit Parts List & Installation Instructions

| Ag Systems | | | | |
|-------------|-------------------------|--|------|--|
| ITEM NO. | PART NUMBER DESCRIPTION | | QTY. | |
| 1 | 103-4496Y1 | Zip Valve 1/4" Nylon, 2-way, SS Ball, 3/8" Push to Connect | | |
| 2 | 113-12-038038 | Stem Elbow - 3/8" Stem x 3/8" QC | 2 | |
| 3 | 137-MGR200-08L | Air Pressure Regulator w/ 60 psi Gauge – ¼" NPT Inlet/Outlet | 1 | |
| 4 | 304-040012-5 | Carriage Bolt - 1/4" x 3/4" G5 | 4 | |
| 5 | 323-04 | 1/4" Flange Nut | 4 | |
| 6 | 330-1024 | Size 10 Flat Washer | 2 | |
| 7 | 340-100012 | Machine Screw - Size 10 x 3/4" | 2 | |
| 8 | 385-043 | Bulk 3/8" Tubing | 20ft | |
| 9 | 385-50-038025-CZ | 3/8" Tube to 1/4 NPT Straight - Pneumatic Fitting | 1 | |
| 10 | 385-51-038025-CZ | 3/8" Tube to 1/4 NPT 90 Elbow - Pneumatic Fitting | 1 | |
| 11 | 475-4852Y1 | QuickDraw Air Purge Regulator/Valve Mounting Bracket | 1 | |
| 12 | 757-97349A200 | Size 6 Thread Forming Screw for Plastic - SS | 3 | |
| 13 | 757-2048N11 | QD Check Valve - 1/4" MPT x 3/8" QC | 1 | |
| 14 | 105-300CPG-038 | 3" Manifold Coupling with 3/8" Tap | 1 | |
| 15 | 100-038025RB | 3/8" MPT x 1/4" FPT Reducer Bushing | 1 | |
| 16 | 105-FC300 | 3" Manifold Clamp | 1 | |
| 17 | 105-300G-H | 3" EPDM Manifold Gasket | 1 | |

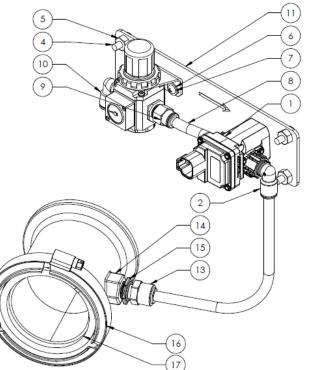

Steps 1-7

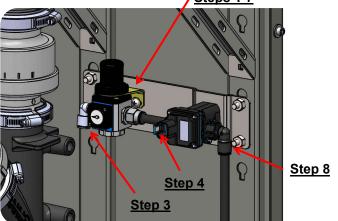

Assembly Instructions for QuickDraw^{MAX} Suction:

Note: For ease of access, it is recommend to remove the back QuickDraw door.

- 1. Follow Steps 1-7 from previous page to mount the air purge assembly in the QuickDraw cabinet.
- 2. Install 3/8" Stem x HB fittings in the outlet of the Zip Valve and install the tapped 3" coupler with 3/8" check valve installed in the desired location downstream of the pump. Note: Installing air purge connection downstream of the pump will mitigate priming issues.
- 3. Connect air supply to the pressure regulator inlet fitting and set the Air Pressure Regulator to 20-25 PSI.
- 4. Plug the "Air Purge" connector in the main QuickDraw Harness into the air supply valve (4-Pin Deutsch Connector).


396-4876Y1 - QuickDraw 3000 Air Purge Installation Manual


Page 3 © 2020 SureFire Ag Systems, Inc.



606-03-300175 - QuickDraw Air Purge Retrofit Kit Parts List & Installation Instructions

| Ag Sys | 310///3 | | |
|-------------|------------------|--|------|
| ITEM NO. | PART NUMBER | DESCRIPTION | QTY. |
| 1 | 103-4496Y1 | Zip Valve 1/4" Nylon, 2-way, SS Ball, 3/8" Push to Connect | |
| 2 | 113-12-038038 | Stem Elbow - 3/8" Stem x 3/8" QC | 2 |
| 3 | 137-MGR200-08L | Air Pressure Regulator w/ 60 psi Gauge – ¼" NPT Inlet/Outlet | 1 |
| 4 | 304-040012-5 | Carriage Bolt - 1/4" x 3/4" G5 | 4 |
| 5 | 323-04 | 1/4" Flange Nut | 4 |
| 6 | 330-1024 | Size 10 Flat Washer | 2 |
| 7 | 340-100012 | Machine Screw - Size 10 x 3/4" | 2 |
| 8 | 385-043-AP1 | Bulk 3/8" Tubing | 1 |
| 9 | 385-50-038025-CZ | 3/8" Tube to 1/4 NPT Straight - Pneumatic Fitting | 1 |
| 10 | 385-51-038025-CZ | 3/8" Tube to 1/4 NPT 90 Elbow - Pnuematic Fitting (Not Used) | 1 |
| 11 | 475-4852Y1 | QuickDraw Air Purge Regulator/Valve Mounting Bracket | 1 |
| 12 | 757-97349A200 | Size 6 Thread Forming Screw for Plastic - SS | 3 |
| *13 | 208-05-4863Y1 | QuickDraw Adapter Aux Output to Air Purge | 1 |
| *14 | 105-220SWPG90 | 2" Manifold Sweep with 1/4" Gauge Port - 90 Degree | 1 |
| *15 | 757-2048N11 | QD Check Valve - 1/4" MPT x 3/8" QC | 1 |
| | | | |

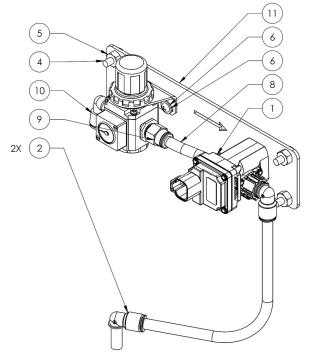

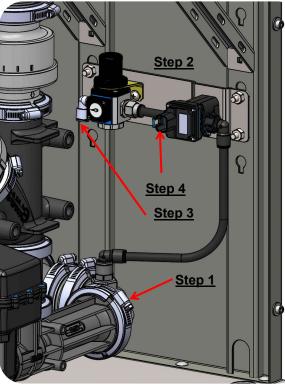

Assembly Instructions for QuickDraw 3000 units sold prior to 2021:

- 1. Replace the 2" full port manifold sweep with the new gauge port sweep and use pipe thread sealant to install the 1/4" MPT x 3/8" QC Check Valve into the gauge port. Re-use the existing clamps and gaskets.
- 2. Follow the instructions from the previous pages for the installation of the Air Purge Assembly.
- 3. Connect air supply to the pressure regulator inlet fitting and set the Air Pressure Regulator to 20-25 PSI.
- 4. Plug the 208-04-4863Y1 QuickDraw Adapter Aux Output to Air Purge into the 6-pin Deutsch connector in the harness connector labeled "Aux" and plug into the air supply valve (4-pin DT).
- 5. A software update will be required for adding the Air Purge feature to QuickDraw units sold prior to 2021. Follow the instructions in the QuickDraw manual for downloading and installing the latest versions of software incorporating the Air Purge functionality.

396-4876Y1 - QuickDraw 3000 Air Purge Installation Manual

Air Purge Controller Setup



| | Sy | stem Setting | gs 2 | |
|---|--|--|--|--|
| Product Valve Valve 1 | Close Time 3.20 Sec | Boost Pump DISABLED | Display Sleep Sleep Time 10 Min | |
| Valve 2 Valve 3 Valve 4 Valve 5 | 1.50 Sec 1.50 Sec 1.50 Sec 1.50 Sec 1.50 Sec | Purge Time 6.0 Sec | Inactive Shutdown Inactive Shutdown Time 60 Min | |
| Valve 6 | 1.50 Sec | Set the desired time for the air purge valve to open aft the completion of the QuickDraw batch. Outlet hose size and length will vary by application, requiring different durations of the purge valve being of Setting the Purge Time to 0.0 Sec will disable the feat | | |
| | | | Remote Settings RUN MENU | |
| _ | N | Ianual Contro | ols | |
| Carrier Flow 1497.7 GAL 0.0 GPM RESET Mass Meter Flow | Valve 1 Valve 2 Valve 3 | | COMMAND POSITIONACTUAL POSITION000000000000 | |
| 274.4 GAL 0.0 GPM RESET Pressure: 0.0 PSI | Valve 4 Valve 5 | | | |
| PRODUCT HOSE RINSE DISABLED | 2 Inch | 3 Inch Valve Rinse | Start Pump Start Boost Kill Pump Start Purge RUN | |
| | | erated by going to the M rt Purge / Stop Purge bu | | |

Air Purge Operation



If Purge is enabled, upon Batch completion the QuickDraw will close all the valves. This takes approximately 6 seconds. While the valves are closing, the indicator light on the top of the QuickDraw will flash and the following screen will be visible:

| Purge | |
|---|-----------|
| Closing Carrier Valve Purge Time 5.0 Sec | |
| Setpoint entered on the 'Setting | s 2' page |
| CANCEL | |

After the valves are closed, the purge valve will open. While the purge valve is open the indicator light on the top of the QuickDraw will be on (not flashing) and the following screen will be visible:

| Purge | |
|------------------------------------|--|
| Purge Active Purge Time 3.1 Sec | |
| Purge Time remaining (countdown) | |
| CANCEL | |

The Purge Time will count down, indicating how long the purge valve will remain open. When the purge cycle is complete, the indicator light on the top of the QuickDraw will turn off.